




SOIL CLASSIFICATION TEST REPORT

Client	Stass Environmental	Ticket No.	S2607
Client Address	PO Box 11, Kalamunda	Report No.	LLS18/5525_1_PSD
Project	Material Assessment	Sample No.	LLS18/5525
Sampling Location	Waroona Pit	Sampled By	Client
Sample Identification	SE1		
Sampling Method	Sampled by Client, Tested as Received	Preparation Method	AS1289.1.1
Sample History	Air Dried	Wet or Dry Sieved	Dry Sieved

PARTICLE SIZE DISTRIBUTION - ANALYSIS BY SIEVING

AS 1289.3.6.1

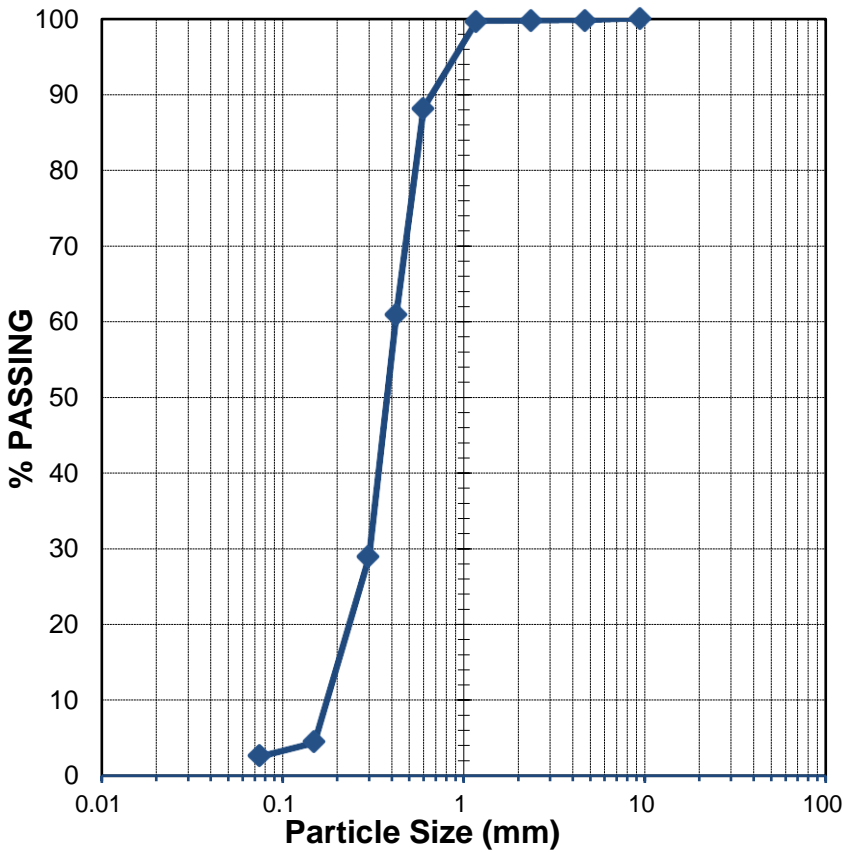

Sieve Size (mm)	Percent Passing Sieve (%)
75.00	
53.00	
37.50	
19.00	
9.50	100
4.75	100
2.36	100
1.180	100
0.600	88
0.425	61
0.300	29
0.150	4
0.075	3

Comments: _____



Accredited for compliance with ISO/IEC 17025 - Testing
Accreditation No. 19872

This document may not be reproduced except in full

Approved Signatory

Name: Matt van Herk
 Function: Laboratory Manager
 Issue Date: 27-November-2018